IGNITION FURNACE TEST INSTRUCTIONS (BC, MB, NB, NL, NS, PE and SK)

The following samples have been forwarded to your laboratory:

Material **I-IGCF-x** (Five samples)

Material I-IGMF-x and II-IGMF-x (Two pre-mixed samples)

Asphalt Cement **I-IGAC-x** (One sample)

A) Ignition Furnace: Reference Procedure ASTM D6307

- 1) While furnace is at room temperature calibrate the furnace balance as described in the furnace manual provided by the manufacturer.
- 2) Set the combustion temperature of 540°C (deemed appropriate for this type of sample) or as indicated for Irradiation type furnace.
- 3) Set the start time (Auto Timer) so that the furnace is at the specified run temperature (see 2) above) for at least 60 minutes before starting the burn of the first sample of the day.
- 4) Set the furnace endpoint to 0.01% of the sample mass (D6307)

B) Sample Preparation

Correction Factor (I-IGCF-x) Samples:

- 1) Five sample bags containing approximately 1450g of mixed aggregates and one sample of asphalt cement are supplied
- 2) Aggregates are to be dried prior to mixing.
- A clean mixing bowl will be buttered by mixing a separate sample of HMA (not supplied). The bowl will be scraped clean of this buttering mix prior to mixing the five samples supplied.
- 4) Mixing temperature for the correction factor samples is 150°C.
- 5) Weigh and record the dried aggregate sample.
- 6) Based on this weight add sufficient asphalt cement (supplied) to produce a mix containing **5.00%**, **I-IGAC-x** (based on total mix).
- 7) Mix the sample as indicated in D-6926
- 8) Transfer the mixed sample to a metal tray, spread it out, cover with metal foil and allow it to cool to ambient temperature.
- 9) Sample is now ready for testing.
- 10) Five samples are provided. Calibration Factor shall be determined from 3 of the 5 samples according to D6307.

Pre-mixed I-IGMF-x and II-IGMF-x Samples:

1) Sample bags containing approximately 1500g of **I-IGMF-x** and **II-IGMF-x**_are supplied and are ready for testing. Determination of moisture content is not required.

C) Ignition Furnace Run:

- Weigh the lid, sample tray, catch pan and retaining bracket on the laboratory balance (TABLE 1 – for I-IGCF-x (Correction Factor) samples and TABLE 3 – for I-IGMF-x and II-IGMF-x (HMA) samples)
- 2) Preheat the sample to be tested to 110°C±5°C (i.e. sufficiently warm to handle). Do not heat for more than one hour.
- 3) Place catch pan under sample tray and spread sample evenly on the tray.
- 4) Place lid over sample tray and secure lid, tray and catch pan with the retaining bracket.

- 5) Weigh total assembly on the laboratory balance and record the mass to 0.1g (TABLE 1 for I-IGCF-x samples and TABLE 3 for I-IGMF-x and II-IGMF-x samples)
- 6) Calculate sample mass (C in both TABLE 1 and TABLE 3)
- 7) Enter the sample mass C in the furnace data system.
- 8) Place the assembly in the preheated furnace and close the door.
- 9) Heat the sample at the specified temperature (540°C) until the difference between consecutive mass loss measurements does not exceed requirements for three one minute intervals.
- 10) Record sample mass after ignition (from data tape) (TABLE 1 F for I-IGCF-x samples and TABLE 3 F for I-IGMF-x and II-IGMF-x samples).
- 11) Remove the assembly from the furnace and allow to cool to ambient temperature and weigh to the nearest 0.1g (TABLE 1 E for I-IGCF-x samples and TABLE 3 F for I-IGMF-x and II-IGMF-x samples).
- 12) Record required data from tapes in TABLES 1 and 3 for I-IGCF-x and I-IGMF-x and II-IGMF-x samples respectively.

NOTE 1: LABORATORIES SHOULD TAKE CAUTION REGARDING NEGATIVE CALIBRATION FACTORS. A LARGE NEGATIVE CALIBRATION FACTOR SUGGESTS THAT THE ASPHALT CEMENT HAS NOT BEEN COMPLETELY BURNED DURING THE IGNITION RUN.

D) Ignited Aggregate Gradation

- 1) Carefully transfer the total residue after ignition to a weighing pan and weigh to the nearest 0.1g.
- 2) Proceed with the washed sieve gradation. Laboratories shall complete the attached work sheets (Tables 1-4) and submit copies of the output tapes from the ignition furnace runs.

Asphalt contents shall be expressed as mass percent of total mixture.

Note 2: Please identify the method used (Method A or B) for the type of furnace by selecting from the dropdown feature on the Reporting Form.

All test results shall be reported online and submitted by **January 7 2022**.

NOTE for laboratories in British Columbia: If your laboratory does not use the 16.0mm sieve, please do not enter zero in the online reporting form. Please cancel this sieve by clicking the box adjacent to the sieve in the reporting form.

An example of a completed report form is shown on Pages 3 and 4.


Important Change for 2022: Your lab's worksheets must be submitted through the portal with your proficiency report. Please combine all worksheets for each portal report into a single pdf prior to uploading. You are required to keep all original worksheet hard copies in a secure dedicated location such as a sealed envelope that is available to CCIL upon request. Do not courier/mail/fax/e-mail the worksheets to CCIL.

DO NOT send reports and worksheets by fax



2020 Asphalt Reporting Form Ignition Furnace

| Ignition Furnace Report - Certification Program | |
|--|--|
| CCIL Confidential Lab # CCIL 999 | |
| ▶ Lab Name: Demo Lab | |
| ▶ Tested by: | |
| Lab Technician Supervisor / Manager Not listed | |
| Please specify | |
| Super Technician | |
| | |

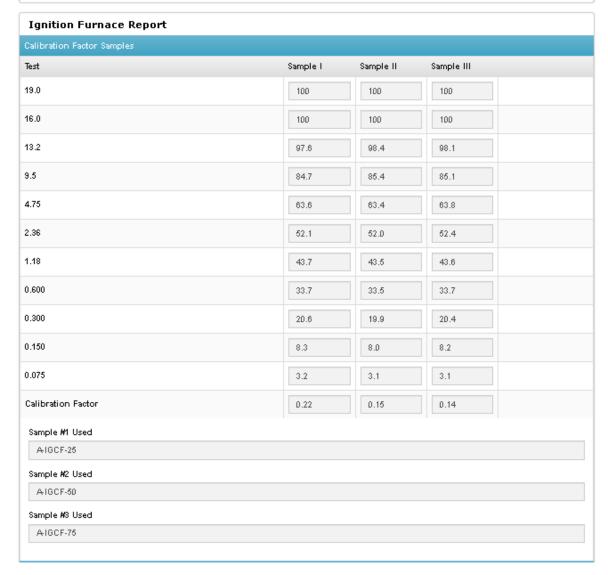

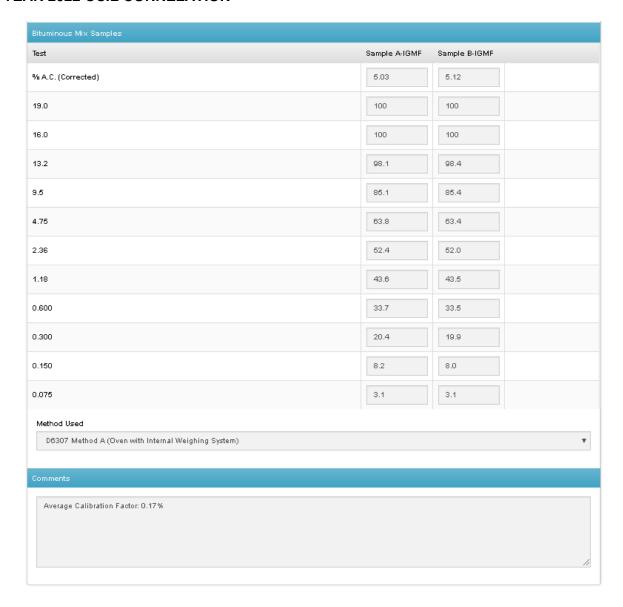


TABLE 1: In-House Prepared Calibration Factor Samples

| General Information | | | | | | | |
|--|---|----------------|----------------|----------|----------------|----------|----------|
| Company Name | | | | | | | |
| Technici | an's Name | | | | Date | | |
| | | Sp | oecific Inform | nation | | | |
| | | | | Calibr | ation Factor S | Samples | |
| | | | Code No. | Code No. | Code No. | Code No. | Code No. |
| | | | | | | | |
| | | La | aboratory Ba | lance | <u> </u> | l | |
| А | Mass of sampl par | • | | | | | |
| В | Mass of sam catch pan, | ple tray, lid, | | | | | |
| C = (B - A) | Initial Mass | of Sample, g | | | | | |
| D | Mass of sample tray, lid, catch pan, sample after ignition, g | | | | | | |
| E = (D - A) | Final mass of sample after | | | | | | |
| | | | Furnace Bala | ince | | | |
| F | Final mass of ignition, g | • | | | | | |
| G = (C - F) | Loss Fu | rnace, g | | | | | |
| H = (G/C) x 100 | Loss Fui | rnace, % | | | | | |
| 1 | Loss Furnace | Correction, % | | | | | |
| J = (H – I) | Total Loss (Appare | | | | | | |
| K | K Total AC added, % | | | | | | |
| L = (J - K) | Calibration | Factor, % | , | | | | |
| | Furnace Temperature Information | | | | | | |
| Test temperature shown on controls, °C | | | | | | | |
| Initial temper | ature from data | tape, °C | | | | | |
| Maximum ter | mperature form o | lata tape, °C | | | | | |
| Final temperature from data tape, °C | | | | | | | |

TABLE 2: Gradation of In-House Prepared Calibration Factor Samples (After Ignition)

| | [| Calibration Factor Samples | | | | | | |
|----------------------------|--|-------------------------------------|-----------|---|---|---|--|--|
| | | Code No. Code No. Code No. Code No. | | | | | | |
| | | | | | | | | |
| Laboratory Balance | Initial Mass, g Final Mass, | | | | | | | |
| Furnace Balance | g Initial Mass, g Final Mass, | | | | | | | |
| | g | | | | | | | |
| | | | AGGREGATE | Ι | Ι | Ι | | |
| Dry mass before washing, g | | | | | | | | |
| Dry mass after washing, g | | | | | | | | |
| | | % Passing | | | | | | |
| | 16.0 mm | | | | | | | |
| | 13.2 mm | | | | | | | |
| z | 9.5 mm | | | | | | | |
| ADATION | 4.75 mm | | | | | | | |
| D A . | 2.36 mm | | | | | | | |
| \simeq | 1.18 mm | | | | | | | |
| O | 600 µm | | | | | | | |
| | 300 µm | | | | | | | |
| | 150 µm | | | | | | | |
| | 75 µm | | | | | | | |

| Laboratory Name: | | |
|------------------|------|------|
| | | |
| Date Tested: | | |

| General Information | | | | | | | |
|--------------------------------------|---|--------------------------|----------------|----------|-------------|----------|----------|
| Company Name | | | | | | | |
| Technici | an's Name | | | | Date | | |
| | | Sı | pecific Inform | nation | | | |
| | | | | Prep | ared HMA Sa | mples | |
| | | | Code No. | Code No. | Code No. | Code No. | Code No. |
| | | | | | | | |
| | | | aboratory Ba | lance | | | |
| А | Mass of sampl par | - | | | | | |
| В | Mass of sam catch pan, | nple tray, lid, | | | | | |
| C = (B - A) | Initial Mass | of Sample, g | | | | | |
| D | Mass of sample tray, lid, catch pan, sample after ignition, g | | | | | | |
| E = (D - A) | Final mass of sample after ignition, g | | | | | | |
| Furnace Balance | | | ance | | | | |
| F | Final mass of ignition, g | sample after (data tape) | | | | | |
| G = (C - F) | Loss Fu | rnace, g | | | | | |
| H = (G/C) x 100 | Loss Fu | rnace, % | | | | | |
| I | Loss Furnace | Correction, % | | | | | |
| J = (H – I) | Total Loss Furnace, % (Apparent AC) | | | | | | |
| CF* | CF* Correction Factor, % | | | | | | |
| L = (J – Asphalt Cement, % | | | | | | | |
| Furnace Temperature Information | | | | | | T | |
| Test tempera | Test temperature shown on controls, °C | | | | | | |
| Initial temper | ature from data | tape, °C | | | | | |
| Maximum ter | mperature form o | data tape, °C | | | | | |
| Final temperature from data tape, °C | | | | | | | |

| * CF = Calibration factor as derived from the testir | ng in TABLE 1 |
|--|---------------|
|--|---------------|

| Date Tested: | | | |
|--------------|--|--|--|
| | | | |

TABLE 4: Gradation of Aggregates from Pre-mixed HMA Samples (After Ignition)

| | | Prepared HMA Samples | | | | |
|---------------|--------------------|----------------------|-----------|----------|----------|----------|
| | | Code No. | Code No. | Code No. | Code No. | Code No. |
| | | | | | | |
| Laboratory | Initial Mass, g | | | | | |
| Balance | Final Mass, g | | | | | |
| Furnace | Initial Mass, g | | | | | |
| Balance | Final Mass, | | | | | |
| | <u>. 3</u> | | AGGREGATE | | <u> </u> | <u> </u> |
| Dry mass befo | ore washing, g | | | | | |
| Dry mass aft | er washing, g | | | | | |
| | | | % Pa | ssing | | |
| | 16.0 mm | | | | | |
| | 13.2 mm | | | | | |
| z | 9.5 mm | | | | | |
| RADATION | 4.75 mm | | | | | |
| DAT | 2.36 mm | | | | | |
| | 1.18 mm | | | | | |
| ŋ | 600 µm | | | | | |
| | 300 µm | | | | | |
| | 150 µm | | | | | |
| | 75 μm | | | | | |

| Laboratory Name: | Date Tested: |
|------------------|--------------|
|------------------|--------------|